

OFFICE OF THE MARION COUNTY SURVEYOR
SECTION RECORD CORNER

SECTION 13 TOWNSHIP 16 RANGE 4

DATE: 11-27-07

PARTY CHIEF: Wilcoxen

CREW: _____

TYPE OF MARKER: Cut 'x' in concrete fd


METHOD OF ESTABLISHMENT: County: 8-4-02

IN. S.P.C. E ZONE NAD '83

NAME: 16041303

N: 509852.7320(m)

E: 69146.1120(m)

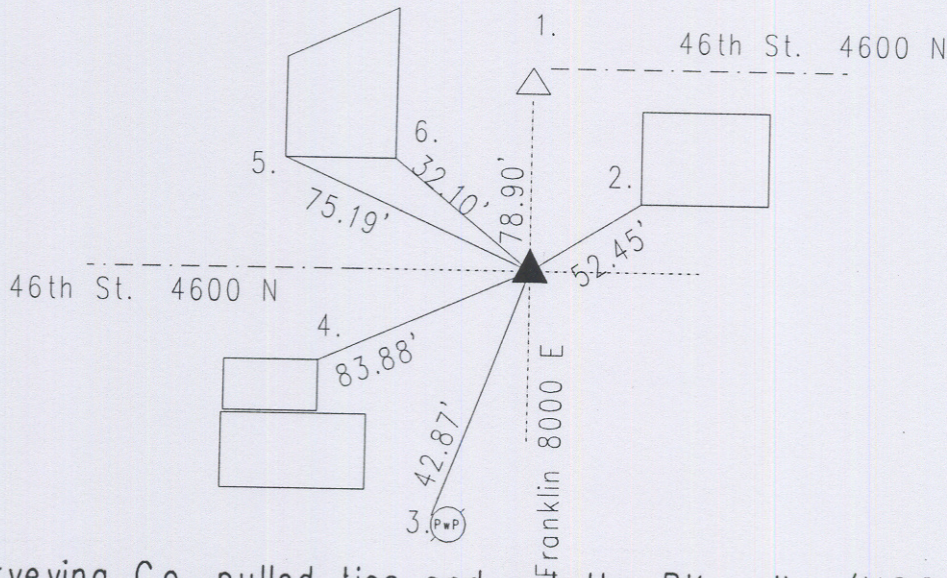

United Surveying Co. pulled ties and set the PK nail w/MCS washer in the wrong location. There was no evidence this corner had been used as a PHOTO MARK. April 4, 1994, Lee Miller reported this corner in ERROR on measured distances between corners to north and the PK nail w/washer as shown. The PK nail w/washer was NOT referenced as the corner by these ties. April 4, 1994, Wilcoxen re-checked these ties comparing them to older ties on file, and found the PK nail w/washer to be in the wrong location. Wilcoxen re-set a small PK nail at the edge of a manhole rim where 'old' ties intersected. The PK nail w/MCS washer was REMOVED at that time. The PK nail w/MCS washer was 0.95'S and 0.65'W of location RESET. Re-tied by Wilcoxen 7-8-99. Re-tied 8-4-02 by Wilcoxen.

REF.	DISTANCE	DESCRIPTION
1.	78.90'	Due N to NW corner of 18-16-5 (boat spike 6-07)
2.	52.45'	SW corner of stucco finish "Swift Air Mechanical"
3.	42.87'	Mag nail NW PwP#107-379
4.	83.88'	NF corner of brick ADDRESS 4540
5.	75.19'	SW corner of brick building
6.	32.10'	SE corner "